



Discovery Series II models, 4.0 V8 1999-2002, and 4.6 V8 2003-2004. Parts fit both models unless otherwise indicated.

Filters

Oil filter	aftermarket	ERR3340P
	Coopers	ERR3340G
	Genuine Land Rover	ERR3340GEN
Air filter	original paper	ESR4238
	K&N high performance	33-2119
	K&N service kit	99-5000
Fuel	(not replaceable on this model)	
Transmission	ZF automatic	RTC4653KIT



Ignition

Spark plugs	double platinum type	NLP100320P	for original equipment use NLP100320
Ignition wire	full set	GWS102	plenum gasket ERR6621 required for changing wires
Distributorless coil pack		ERR6045	2 per vehicle
Crank sensor		ERR7354	
Knock sensor		NSC100650	
Cam sensor		ERR6169	
O2 sensor	front	MHK100920	2 per vehicle
	rear	MHK100930	2 per vehicle
Temperature sensor		MEK100160	up to 3A818214
		MEK500130	from 3A818215 on



Serpentine Belt no 'ACE'
with 'ACE'

ERR6898G	"ACE" is Active Cornering Enhancement
ERR6896	


Ancillary Rotating Assemblies

Water pump		STC4378P	New: sold outright, no core charge, no exchange required
Viscous coupling (fan clutch)	'99-'02	ERR4996	for OEM use STC4378G
Fan, engine driven	'99-'02	ERR4960	4.0 engines
Fan and viscous coupling	'03-'04	PGG000080	4.0 engines
Steering pump		QVB500080	4.6 engines
'ACE' pump		ANR6502	'ACE' fluid, 16 oz. bottle
Alternator	'99-'03	ERR6413	LRN2265
	'03-'04	YLE500090	up to 3A239591: no core charge
			from 3A239592 : no core charge
Starter		NAD101490P	
Belt tensioner		ERR6439	
Idler pulley, 70mm (by tensioner)		PQR500060	
Idler pulley, 80mm (by p.s. pump)		PQR101150	



Gaskets, Seals

Head set	head bolts see below	STC4082	
Head gasket only		LVB500030G	sold each:
	gasket replacement requires new head bolts		ERR2943 x 7 & ERR2944 x 3 per head
Valve cover gasket		LVC100260G	sold each
Intake Manifold:	Valley gasket	LKJ500020G	
	Plenum to intake manifold	ERR6621	2 req.
	Water manifold to plenum	ERR6622	2 req.
Valley gasket end seals		ERR7283	2 per head
Exhaust manifold gaskets		ERR6733	
Oil pan gasket		LVF100400	
	Drain plug crush washer	ALU1403L	
Timing cover seal		ERR7280	
Main seal, front		ERR6490	
	rear	ERR2640	
	Rear retainer "T" seals	LUN000010	2 required
Water pump gasket		ERR4077	
Throttle body gasket kit		MGM000010K	

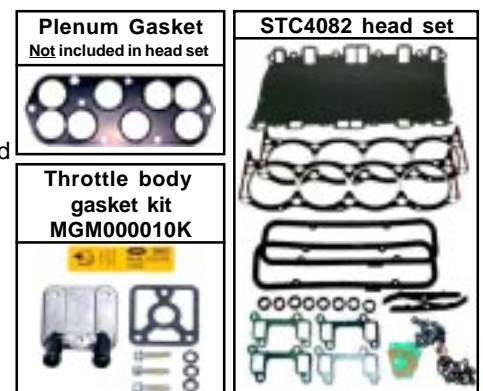

26007 Huntington Lane, Unit 2, Valencia, CA. 91355 8-4, Mon.-Fri.
British Pacific is an independent distributor of Land Rover parts: LR part numbers used for identification purposes only. Not all parts listed are stocked in Genuine Land Rover.